



This Product Information Note covers all RLS tape libraries (RLS-4xxx, RLS-5xxx, RLS-6xxx and RLS-8xxx).

700118 Revision 0.105 5 APR 2007

Enhancements

1. Add support for IBM LTO 4 tape drive

700118 Revision 0.104 14 DEC 2006

Enhancements

1. Added support for AIT-5 tape drives (SDX-1100)
2. Added support for IBM LTO DFA tape drives
3. Added models 8236D and 8244D
4. Improve reliability of SAIT cartridge picking.

Bug Fixes

1. Now properly initialized IBM LTO tape drives

700118 Revision 0.100 19 SEP 2005

Enhancements

1. Added LTO 2 Half-High model and tape drive support
2. Add 501927 sensor PCBA support
3. Add I/O Port feature to 8216H
4. Add support for full-sized 160W power supply

Bug Fixes

2. Fixed 501927 PCBA firmware
3. Fixed Inquiry and front panel text on 8436H and 8444H (used to say 8236H and 8244H)
4. Fixed bug in Move Medium command that returned GOOD status without being executed.

700118 Revision 0.97 16 MAY 2005

Enhancements

5. Add RLS-8204 models and supporting menus

700118 Revision 0.94 23 FEB 2005

Enhancements

1. Improved the door unlatching reliability.

Bug Fixes

1. Changing tape drive IDs to values greater than 1 through Q-Link now function properly.



700118 Revision 0.93 **31 JAN 2005**

Enhancements

1. RLS-6227 only: Improved the reliability of loading a tape into an SLDT drive.

700118 Revision 0.92 **31 JAN 2005**

Enhancements

1. RLS-82xx only: Improved the reliability of loading a tape into an SLDT drive.

700118 Revision 0.91 **11 JAN 2005**

Bug Fixes

1. The SCSI Test Unit Ready command now returns a Check Condition when the TLS is scanning inventory regardless of the setting of [Configuration\Advanced\Changer\Busy](#). This solved a timeout problem with Fibre Channel bridges that caused the Medium Changer to disappear from the bus. Now works like TLS.

700118 Revision 0.90 **19 NOV 2004**

Enhancements

1. RLS-82xx only: Added support for LTO 3 drives.

Bug Fixes

1. RLS-4xxx only: Will now scan the barcode of a cartridge in the handler when the inventory is violated.
2. Can now remove the entire magazine from the VIOP.

700118 Revision 0.85 **5 OCT 2004**

Enhancements

1. RLS-4xxx only: Improved loading reliability for AIT tape drives

700118 Revision 0.83 **15 SEP 2004**

Bug Fixes

1. RLS-4xxx only: Corrected SDX-900V/L menu string
2. [Maintenance\Log\Display Screen](#) no longer locks the log

700118 Revision 0.82 **9 SEP 2004**

Enhancements

1. Added SDX-700V/L, SDX-900V/L and SDLT 600 drive types
2. Reduced time to scan the inventory when using VIOP
3. Detect misloaded cartridge during bulk loading and provide a recover algorithm instead of a fault.

Bug Fixes

1. Dismissing a fault message no longer hangs the menu system
2. Fixed re-sync problem with carousel